

# **INSTRUCTION SHEET**

# Photoelectric Switch with Built-in Power Supply SA1U Series

Universal Voltage - DC Power Types/With or Without Time-delay Outputs


Detection Mode	Universal Voltage Type	DC Power Type	
Through-beam	SA1U-T50M (T)	SA1U-T50MW (T)	
Polarized Retro-reflective	SA1U-P07M (T)	SA1U-P07MW (T)	
Diffuse-reflective	SA1U-D01M (T)	SA1U-D01MW (T)	
Background Suppression	SA1U-B02M (T)	SA1U-B02MW (T)	

Confilm that the delivered product is what you have ordered. Read this instruction sheet to make sure of correct operation. Make sure that the instruction sheet is kept by the end user.


## SAFETY PRECAUTIONS

# ⚠ CAUTION


Caution notices are used where inattention might cause personal injury or damage to equipment.



# 2 Dimensions (mm)

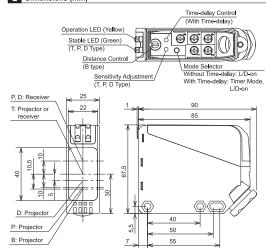

# 3 Installation



Screw

Gland

Cover Screw

Mounting Screw

Tightening Torque

0.6 to 1.0

4.0 to 6.0

0.5 to 0.8

0.8 to 1.2

Tighten all screws surely to maintain the water-proof characteristics, (Except for UL / c-UL)

Excessive tightening causes damage. Tighten the screws within the tightening torque range shown at

4 Specifications

Sensi	Sensing Method			Through-beam	Polarized Retro-reflective	Diffuse-reflective	Background Suppression			
Type No.	Universal Voltage	Without Time-delay	SA1U-T50M	SA1U-P07M	SA1U-D01M	SA1U-B02M				
		age	With Time-delay	SA1U-T50MT	SA1U-P07MT	SA1U-D01MT	SA1U-B02MT			
	DC	Without Time-delay	SA1U-T50MW	SA1U-P07MW	SA1U-D01MW	SA1U-B02MW				
	Pow	er	With Time-delay	SA1U-T50MWT	SA1U-P07MWT	SA1U-D01MWT	SA1U-B02MWT			
Specifications	Sensing Range		nge	50m	0.2 to 7m (Using the attached reflector)	1m (200 × 200mm white mat paper)	0.2 to 2m (200 × 200mm white mat paper)			
	Detectable Object		Object	Opaque	Opaque/Specular	Opaque/Specular	Opaque			
	Hysteresis			-	-	20% maximum of operation distance	15% maximum of operation distance			
	Light Source Eiement		e Eiement	Infrared LED	Red LED Infrared LED					
	Extraneous Light immunity		Light immunity	Sunlight 10000lx maximum, Incandescent lamp 5000lx maximum						
	Temperature Range		e Range	-25 to 60 ℃(no freezing) (Note 1), Storage temperature: -40 to 70 ℃ (no freezing)						
	Operating Humidity		lumidity	35 to 85% RH (storage temperature)						
	Degree of Protection		Protection	IP67 (IEC/EN60529) NEMA TYPE 1 (For UL / c-UL)						
age	Power Voltage		ige	21.6 to 264V AC 50/60Hz, 10.8 to 264V DC (Ripple p-p 10% maximum)						
Universal Voltage Type	Power Consumption		eumption	Projector: 3 VA maximum	I 3 VA maximum					
Sal V			sampuon	Receiver: 3 VA maximum						
yers	Output			Electromechanical SPDT, Swithing capacity: 250V AC · 3A (resistive load), 30V DC · 3A (resistive load)						
5	Response Time		lime .	20ms maximum						
	Power Voltage		ige	10 to 30V DC (Ripple p-p 10% maximum)						
Type	Power Consumption		numption	Projector: 20 mA maximum	A maximum 30 mA maximum					
			samption	Reciever: 25 mA maximum	ciever: 25 mA maximum					
ē				NPN and PNP transistor open collector						
Power	Resistive Load 100 mA maximum   Output Voltage 30V DC maximum									
2 2	Output Voltage			30V DC maximum						
"	Voltage Drop		e Drop	2.4V maximum						
	Response Time 1 ms maximum									

Note 1: Maximum 50 °C in case of UL / c-UL Listed product.

#### 5 Notes for Operation

- · Prevent incidence of reflected light from the floor or wall.
- Do not expose the photoelectric switch to sunlight or other direct light projections.
- Do not strike the photoelectric switch with a hammer when installing, otherwise the waterproof characteristics will be impaired. (Except for UL / c-UL)
- For preventing the transient state when turning power on, a circuit to turn output off (universal voltage: 50 ms. DC power: 100 ms) is contained. On the timer-function model, time-delay operation starts when the output is released from the off state. Take care of the operation when
- Do not use the photoelectric switch under conditions exceeding the rated operating temperature, vibration resistance, and shock resistance.
- Use the photoelectric switch within the rated power voltage
- When using a switching power supply, connect the FG (frame ground) terminal to a proper
- When compliance with the EU Low Voltage Directive is required, connect an EN approved fuse outside the power terminals of the universal voltage type.
- When adjusting the sensitivity, adjusting the time-delay or selecting the mode (without Timedelay type), turn the control as shown below, to a torque of 0.03 N •m maximum.
- The cover has to be always fixed except for when the wiring or the adjustment is being set. otherwise this may cause malfunction of the switch. Install the cover maintain the water-proof characteristics, install the cover in a regulated position.
- Do not install the SA1U photoelectric switches in areas where the switches are subject to water oil and chemicals
- For through-beam types, optional slits SA9Z-S15 and SA9Z-S16 are available to reduce the range of intereference and to detect minute objects. When using the optional slit, take the following into consideration.
- · Wipe the lens surface of the switch with a soft dry cloth before sticking the adhesive tape side of the slit on to the lens surface
- · When attaching the slit, align the ends of the slit with the ends of the lens.

Type No. and the wiring diagram, are indicated on the housing and the cover. When installing the cover, confirm that the cover type the agrees with the housing

#### 6 Wiring Diagram Universal Voltage Type DC Power Type Other than the through-beam Other than the through-beam type projector type projector Terminal No. Terminal No. Power Voltage oltage/ 24 to 240V AC Load Power Suplly 50/60Hz ㅎ 12 to 240V DC Relay Contact (SPDT) 0V 12 to 24V DO Internal Circuit \*--- External Wiring Internal Circuit ----O-External Through-beam type projector Through-beam type projector Terminal No.

Sensino

12 to 24V DC

Internal Circuit +---O----- External

Circuit


24 to 240V AC


12 to 240V DC

50/60Hz

Internal Circuit + - - O --- External Wiring

#### ■Cable Connection






### ①Connect wires starting from the lower terminals.


# 2)Install the cover using the captire screw.

Use a cable of 8 to 10 mm in diameter to ensure water- and dust-proof characteristics(Except for UL / c-UL). Two gland packings are supplied; for cables of 8 to 9 mm and 9 to 10 mm in diameter. In case of UL / c-UL Listed product, use 9 to 10mm gland packing for Universal voltage type, use 8 to 9mm gland packing for DC power type. Use a proper gland packing and a gland washer, and tighten the gland firmly. Keep the cable insulation within 10 mm from the gland packing as shown above. Make sure that the gland washer is placed in the gland packing correctly.

- ·Use UL Listed cable for Universal voltage type, Type S or SJ, and 18AWG conductor. (For UL / c-UL)
- ·Use UL Listed cable for DC power type, Type MTW, and 20AWG conductor. (For UL / c-UL)
- ·Turn off the power supply before wiring.
- ·Connect correctly to prevent damage
- The power voltage must not exceed the rated range.
- The cable should not be run in the same wire duct with other power supply, motor, or electromagnetic lines because induction noise will cause malfunction or damage to the photoelectric switch
- ·Cable extension is allowed up to 100m using a cabture cable with core wires of 0.3 mm<sup>2</sup> or more. On the DC power supply type, consider the voltage drop by the resistance of the cable. When connecting crimping terminals, note the direction of the crimping part as shown.



#### Applicable Crimping Terminal Dimensions



·When using crimping terminals, wrap the terminal with insulating tubes

· Each screw terminal can accept only one crimping terminal.

#### 7 Optical Axis Alignment & Sensitivity Adjustment

#### (1) Through Beam Type

Direct the projector and the receiver face by eye measure and fasten them tentatively. Direct the receiver upward, downward, and sideways and lock the projector in the middle where the indicator on the receiver goes on.

#### (2) Polarized retro-reflective


Direct the sensor upward, downward, and sideways and lock the reflector in the middle where the indicator goes on or off.

#### (3) Diffuse-reflective

Place the sensing object and direct the sensor upward, downward, and sideways and lock the reflector in the middle where the indicator goes on or off. Without the sensing objects in place check the indicator goes off. If the background influences, make the sensitivity adjustment as follows.

- ① With the sensing object in place, turn the sencitivity adjusting control clock wise from MIN position until the indicator goes on (point A).
- 2 Remove the object, then the indicator will go off. Turn the sensitivity adjusting control further clockwise until the indicator goes on again by detecting the background (Point B).
- 3 Set the sensitivity adjusting control at Point C, the middle point between A and B.
- NOTE: When adjusting the sensitivity, turn the control as shown below, to a torque of 0.03 N •m maximum.
- (4) Make the sensitivity adjustment of the background suppression (BGS) as follows. (At dark on operation, read lighting the operation indicator in a different way as turning off
- and adjust it.) First, direct the sensor and place the object, turn the sensitivity adjusting control
- counterclockwise until the indicator goes off. Then turn the sensitivity adjusting control clockwise until the indicator goes on (Point A).
- 2 Remove the object, then the indicator will go off. Turn the sensitivity asjusting control further clockwise until the indicator goes on again by detecting the background (Point B) (\*1).
- (3) Set the sensitivity adjusting control at Point C, the middle point between A and B (\*2) \*1: Make one turn or more clockwise from point A and set the position as point C when the
- background is too far and the operation LED dose turn on.
- \*2: There may be more than 1 turn between points points A and B, since this photelectric switch incorporates a 6-turn adjuster.
- \*3: Sensing range becomes longer when turned clockwise
- \*4: Stable LED is not incorporated in BGS type.

# 8 Operation Chart (With time-delay outputs)

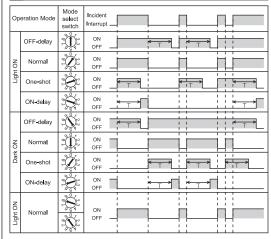

# 9 Precaution for Disposal

# IDEC CORPORATION http://www.idec.com

#### Manufacturer: IDEC CORPORATION

2-6-64, Nishimiyahara, Yodogawa-ku, Osaka 532-0004, Japan

# EU Authorized Representative: APEM SAS

55. Avenue Edouard Herriot BP1.82303 Caussade Cedex, France

# APEM COMPONENTS LIMITED

Drakes Drive, Long Crendon, Buckinghamshire, HP18 9BA, UK

2021 10